



NOTE:

*: Refer to the '99 PAJERO SPORT Workshop Manual (Pub. No. PWJE9812).

Code No. P0125 Feedback system	Probable cause
<p>Range of Check</p> <ul style="list-style-type: none"> • The engine coolant temperature is approx. 80°C or more. • During stoichiometric feedback control • The vehicle is not being decelerated. <p>Set Conditions</p> <ul style="list-style-type: none"> • Right bank oxygen sensor (front) output voltage has been higher or lower than 0.5 V for at least thirty seconds. • Left bank oxygen sensor (front) output voltage has been higher or lower than 0.5 V for at least thirty seconds. 	<ul style="list-style-type: none"> • Malfunction of oxygen sensor (front) • Open or short circuit in the right bank oxygen sensor (front) circuit or loose connector contact • Open or short circuit in the left bank oxygen sensor (front) circuit or loose connector contact • Malfunction of engine-ECU <M/T> • Malfunction of engine-A/T-ECU <A/T>



